

This errata sheet provides information about known device issues affecting Arria® V production devices.

Device Errata for Arria V Production Devices

Table 1 lists the specific device issues and the affected Arria V production devices.

Table 1. Arria V Production Device Issues (Part 1 of 2)

Issue	Affected Devices	Planned Fix
“JTAG Programming of 28-nm Devices”	All Arria V Devices	None
“EMAC RMII PHY Interface is Only Supported Through the FPGA Fabric”	All Arria V SX and ST Devices	None
“Hard Processor System Level 2 Cache Error Correction Code” Enabling ECC in the L2 cache may cause false ECC interrupts.	All Arria V SX and ST Devices	Rev C silicon
“EMIF Maximum Frequency Specification Update” The EMIF maximum frequency specification has been updated.	All Arria V GX and GT Devices	None
“SEU Internal Scrubbing” SEU internal scrubbing has usage restrictions.	All Arria V GX and GT Devices	None
“Fractional PLL Phase Alignment Error” The fractional PLL (fPLL) has a silicon sensitivity that causes the static phase error to operate beyond the Quartus® II software expectation.	All Arria V GX and GT Devices	Refer to Table 4.
“Bit Errors on the LVDS RX Channels Using DPA” DPA or soft-CDR mode is not supported for specific LVDS data rates.	All Arria V GX and GT devices	For the Quartus® II and die revision solutions in different LVDS DPA data rate ranges, refer to Table 5 and Table 6. Devices that support the complete range of LVDS DPA data rate will begin rolling out in Q3 2013.
“Configuration via Protocol (CvP)” CvP and Autonomous HIP functionality is not supported.	All Arria V Devices except 5AGTC7, 5AGXA7, 5AGXA5, 5ASXB3, 5ASXB5, 5ASTD3 and 5ASTD5 devices.	Devices that are CvP capable will begin rolling out in Q2 2013
“Usermode High Icc” High Icc observed when entering User mode.	All Arria V GX and GT Devices	None

Table 1. Arria V Production Device Issues (Part 2 of 2)

Issue	Affected Devices	Planned Fix
<p>“Unused or Idle Transmitter Maximum Data Rate Degradation”</p> <p>Currently unused or idle transmitter’s maximum data rate can degrade over a period.</p>	All Arria V GX and GT Devices	None
<p>“False Configuration Failure in Active Serial Multi-Device Configurations”</p> <p>In Active Serial (AS) multi-device configuration mode, the error checking for CONF_DONE release may not operate correctly.</p>	All Arria V devices	None
<p>“Hard Processor System PLL Lock Issue After Power-on Reset or Cold Reset”</p>	All Arria V SX and ST Devices	Rev D silicon: March, 2015
<p>“Signal Detect Issue in PCIe Configuration”</p>	All Arria V GX/SX production devices	<ol style="list-style-type: none"> Quartus Prime version 16.1.1 Production devices with date code 1707 onwards

JTAG Programming of 28-nm Devices

JTAG configuration of 28-nm devices does not operate correctly when you initiate a PAUSE_DR instruction during configuration. In this scenario, JTAG configuration fails when pausing configuration in the middle of the bit stream by entering into the PAUSE-DR state and continuing to clock the TCK input. The failure is indicated by CONF_DONE staying low after all of the data has been clocked into the FPGA while nSTATUS remains high.

The PAUSE-DR feature works correctly with normal IEEE 1149.1 JTAG test operations.

Workaround

If you require pausing in the middle of the bit stream during JTAG configuration, halt the TCK and do not enter the PAUSE-DR state. Restart the TCK when you resume the configuration.

EMAC RMII PHY Interface is Only Supported Through the FPGA Fabric

The default setting of the physe1_x field in the System Manager EMAC Control Group's ctrl register cannot be used to configure an HPS I/O RMII PHY interface. Because the HPS I/O timings do not support RMII protocol, encodings 0x0 and 0x1 are the only valid values in the physe1_x field. Selecting the 0x0 encoding routes the GMII/MII signals to the FPGA fabric only, and selecting the 0x1 encoding routes the RGMII interface to the HPS I/O only. If the physe1_x encoding is left as 0x2, the HPS PHY interface does not function properly.

Workaround

If an RMII PHY interface is required, the `physe1_x` field should be set to `0x0` so that the GMII/MII signals are routed to the FPGA. You can design an RMII soft adaptor in the FPGA configuration file that converts these MII signals to an RMII PHY interface that is mapped to the FPGA I/O pins. Refer to the “Programming Model” section of the EMAC chapter in the *Arria V Device Handbook, Volume 3: Hard Processor System Technical Reference Manual* for more information about how to initialize the EMAC Controller and interface.

Hard Processor System Level 2 Cache Error Correction Code

After enabling the L2 cache ECC feature, false ECC errors may occur.

For affected devices, L2 cache ECC can be used and this issue avoided by setting the `mpu_base_clk` to a maximum frequency as follows:

- Fast speed grade (-4) — 500 MHz
- Mid speed grade (-5) — 400 MHz
- Slow speed grade (-6) — 300 MHz


 If you are not using the L2 ECC feature, refer to the [Arria V Device Datasheet](#) for the maximum frequency of the `mpu_base_clk`.


Table 2 identifies the fixed silicon by die revision for each device.

Table 2. Device and Revision Fixed

Device	Revision without Fix	Revision with Fix
5ASXB3	Rev A & B	Rev C
5ASXB5	Rev A & B	Rev C
5ASTD3	Rev A & B	Rev C
5ASTD5	Rev A & B	Rev C

Figure 1 shows the silicon revision as identified by the 4th letter of the Lot ID.

Figure 1. Altera Date Code Marking Format

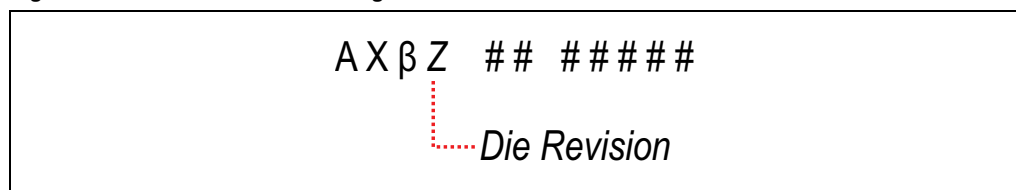

EMIF Maximum Frequency Specification Update

To achieve timing closure, the external memory interface (EMIF) maximum frequency specification has been updated.

Table 3. Arria V EMIF Maximum Frequency Specification Update ⁽¹⁾, ⁽²⁾

Device	Speed Grade	Memory Type	Memory Topology	Depth Expansion	Interface Type	Original Maximum Specifications (MHz)	Updated Maximum Specifications (MHz)
Arria V GX	C4	DDR2	Component	2 Chip Selects	Hard Controller	350	333
Arria V GX/GT	I3	DDR2	Component	2 Chip Selects	Hard Controller	350	333
Arria V GX/GT	I3	DDR3/DDR3L	Component	1 Chip Select	Hard Controller	533	533 ⁽³⁾

Notes to Table 3:

- (1) The stated performances apply to component topology only. Hard controllers do not support DDR2 and DDR3 DIMM configurations.
- (2) For changes to other variants and slower speed grades, please refer to the [External Memory Interface Spec Estimator](#).
- (3) Upgrade the DDR3 SDRAM/DDR3L SDRAM component from 533 MHz to 667 MHz to achieve the specified maximum frequency.

Solution

These maximum frequency specifications have been updated in the [External Memory Interface Spec Estimator](#).

SEU Internal Scrubbing

The SEU internal scrubbing feature has usage restrictions. For additional information, contact [mySupport](#).

Fractional PLL Phase Alignment Error


The fPLL has a silicon sensitivity that causes the static phase error to operate beyond the Quartus® II software expectation. The frequency range and jitter performance of the fPLL meet the datasheet specification. This sensitivity is a time-zero failure, which means a design affected by this issue will show failure immediately upon a given device operation over expected operating conditions or will never show the issue.

The following usage modes may be affected:

- When the fPLL is used for phase compensation. For example, applications that may use phase compensation include LVDS, board trace matching, or FPGA skew compensation, such as zero delay buffering.
- Specific IP cores that require fPLL usage
- Inter-clock domain transfers involving fPLL usage

Workaround

Customers can implement design techniques to mitigate inter-clock domain transfers and use the Altera® tool to evaluate fPLL usage and determine if designs may be affected by this issue.

 To determine if your design may be affected, use the [Altera fPLL Usage Evaluation Tool](#).


If you believe your design is affected by this issue, please contact [mySupport](#) for further assistance.

Long-Term Fix

This issue is, or will be fixed in the silicon die revision shown below. [Table 4](#) identifies the fixed silicon by die revision for each device.

Table 4. Fixed Silicon by Die Revision


Family	Device	Fixed Die Revision
Arria V GT	5AGTD7	C
	5AGTD3	D
	5AGTC7	B
	5AGTC3	B
Arria V GX	5AGXB7	C
	5AGXB5	C
	5AGXB3	D
	5AGXB1	D
	5AGXA7	B
	5AGXA5	B
	5AGXA3	B
	5AGXA1	B
Arria V ST	5ASTD5	B
	5ASTD3	B
Arria V SX	5ASXB5	B
	5ASXB3	B

 For an explanation of the date code and revision marking format, refer to [Figure 3](#) on [page 9](#).

Bit Errors on the LVDS RX Channels Using DPA

DPA mode or soft-CDR mode is not supported for specific LVDS data rate as shown in [Figure 2](#). If the RX channels with DPA are operating in the unsupported zone, bit errors may occur. This limited LVDS data rate support impacts early die revision Arria V GX/GT device when LVDS receiver channels operating in DPA mode or soft-CDR mode. LVDS receiver channels operating in non-DPA are not affected. The unsupported data rate zones are dependent on device speed grade as shown in [Figure 2](#). The affected Arria V GX/GT die revisions are shown in [Table 7](#).

Figure 2. Arria V GX/GT LVDS DPA RX Supported and Unsupported Data Rates

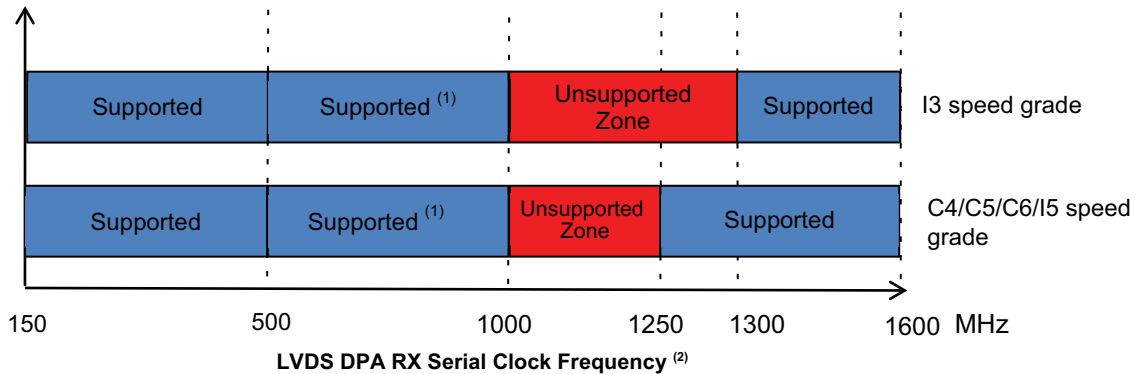

Notes to [Figure 2](#):

- (1) Supported with recompilation in Quartus II version 13.0 and later. Not supported in Quartus II version 12.1SP1 and earlier. If the RX channels with DPA are operating in this zone with Quartus II version 12.1SP1 and earlier, bit errors may occur.
- (2) The scale of the LVDS DPA RX serial clock frequency is for illustration purposes only.

Solution

For the LVDS data rate solutions in the unsupported zones, refer to [Table 5](#) and [Table 6](#).

Table 5. Arria V GX/GT Solution for C4/C5/C6/I5 Speed Grades (Part 1 of 2)

LVDS DPA RX Data rate	Solution for Die Revision without Fix	Solution for Die Revision with Fix ⁽¹⁾
150 Mbps ≤ Data Rate ≤ 500 Mbps	No impact. No action required.	No impact. No action required.
500 Mbps < Data Rate ≤ 730 Mbps	Design recompilation in Quartus II 13.0 and onwards	Design recompilation in Quartus II 13.0 and onwards
730 Mbps < Data Rate ≤ 1000 Mbps	Design recompilation in Quartus II 13.0 and 13.0 SP1 ⁽²⁾	Design recompilation in Quartus II 13.0 and onwards ⁽²⁾
1000 Mbps < Data Rate < 1250 Mbps	Requires revised silicon ⁽¹⁾	Design recompilation in Quartus II 13.1 ⁽³⁾
1250 Mbps ≤ Data Rate < 1300 Mbps	No impact. No action required ⁽⁴⁾ .	No impact. No action required ⁽⁴⁾ .

Table 5. Arria V GX/GT Solution for C4/C5/C6/I5 Speed Grades (Part 2 of 2)

LVDS DPA RX Data rate	Solution for Die Revision without Fix	Solution for Die Revision with Fix ⁽¹⁾
1300 Mbps ≤ Data Rate ≤ 1600 Mbps	No impact. No action required.	No impact. No action required.
Notes to Table 5: (1) The die revision for devices with fix is shown in Table 7. (2) The designs operating at these data rates compiled in Quartus II 13.0 and 13.0 SP1 support die revisions with and without fix, and no design recompilation is required in Quartus II 13.1. The designs compiled in Quartus II 13.1 and onwards only support die revision with fix. Please contact mySupport for further assistance. (3) Please contact mySupport for compilation support on the die revision with fix prior to Quartus II 13.1 (4) The designs operating at these data rates compiled in Quartus II prior to 13.1 support die revisions with and without fix, and no design recompilation is required in Quartus II 13.1. The designs compiled in Quartus II 13.1 and onwards only support die revision with fix. Please contact mySupport for further assistance.		

Table 6. Arria V GX/GT Solution for I3 Speed Grade

Data rate	Solution for Device Revision without Fix ⁽¹⁾	Solution for Device Revision with Fix ⁽¹⁾
150 Mbps ≤ Data Rate ≤ 500 Mbps	No impact. No action required.	No impact. No action required.
500 Mbps < Data Rate ≤ 730 Mbps	Design recompilation in Quartus II 13.0 and onwards	Design recompilation in Quartus II 13.0 and onwards
730 Mbps < Data Rate ≤ 1000 Mbps	Design recompilation in Quartus II 13.0 and 13.0 SP1 ⁽²⁾	Design recompilation in Quartus II 13.0 and onwards ⁽²⁾
1000 Mbps < Data Rate < 1250 Mbps	Requires revised silicon ⁽¹⁾	Design recompilation in Quartus II 13.1 ⁽³⁾
1250 Mbps ≤ Data Rate < 1300 Mbps	Requires revised silicon ⁽¹⁾	Design recompilation in Quartus II 13.1 ⁽³⁾
1300 Mbps ≤ Data Rate ≤ 1600 Mbps	No impact. No action required.	No impact. No action required.
Notes to Table 6: (1) The die revision for devices with fix is shown in Table 7. (2) The designs operating at these data rates compiled in Quartus II 13.0 and 13.0SP1 support die revisions with and without fix, and no design recompilation is required in Quartus II 13.1. The designs compiled in Quartus II 13.1 and onwards only support die revision with fix. Please contact mySupport for further assistance. (3) Please contact mySupport for compilation support on the die revision with fix prior to Quartus II 13.1		

Table 7. Arria V GX/GT Device Revision with Fix (Part 1 of 2)

Member code	Revisions without Fix	Revision with Fix ⁽¹⁾
5AGXA1	A	B
5AGXA3	A	B
5AGXA5	A	B
5AGXA7	A	B
5AGXB1	A, B, C	D
5AGXB3	A, B, C	D
5AGXB5	A, B	C
5AGXB7	A, B	C
5AGTC3	A	B
5AGTC7	A	B
5AGTD3	C	D

Table 7. Arria V GX/GT Device Revision with Fix (Part 2 of 2)

Member code	Revisions without Fix	Revision with Fix ⁽¹⁾
5AGTD7	A, B	C
Note to Table 7: (1) Refer to Figure 3 for the Arria V device's top side data code. This issue is fixed if the fourth alphanumeric character (Z) from the left printed on the top side of the device is equal to or later in the alphabet than the letter shown in the Revision with Fix column.		

Dynamic Frequency Range Constraints for DPA and Soft-CDR Mode

When LVDS receivers are implemented with dynamic frequency range, either with reconfigurable PLL, or via input frequency changes, the frequency range of the serial clock (fast clock) is limited to the following range ([Table 8](#)) in a single design compilation.

Table 8. Dynamic Frequency Range Constraints for DPA and Soft-CDR mode

Frequency Range Support for PLL Reconfiguration for LVDS Receivers with DPA ⁽¹⁾	Device Revision without Fix	Device Revision with Fix
150 Mbps ≤ Data Rate ≤ 500 Mbps	Supported	Supported
500 Mbps < Data Rate ≤ 730 Mbps	Supported	Supported
730 Mbps < Data Rate < 1300 Mbps	Not supported	Supported
1300 Mbps ≤ Data Rate ≤ 1600 Mbps	Supported	Supported
Note to Table 8: (1) PLL reconfiguration or dynamic input frequency changes is only allowed within the defined range.		


Please contact [mySupport](#) for further assistance.

Configuration via Protocol (CvP)

The fix involves a new die revision. You can use the die revision character in the Date Code to determine whether or not the device supports CvP.

CvP update can only be used at Gen1 data rates. CvP is supported if the fourth alphanumeric character (Z) from the left printed on the top side of the device is equal to or later in the alphabet than the letter shown in the Revision with Fix column of [Table 9](#).

[Figure 3](#) shows an Arria V device's top side date code.

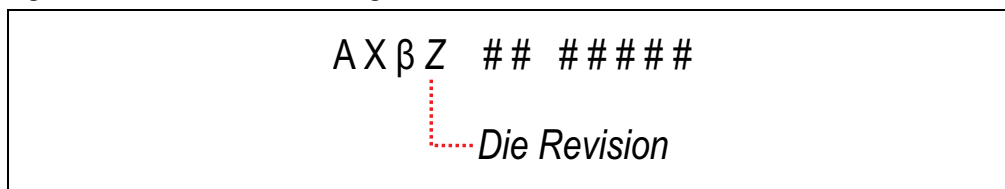Figure 3. Altera Date Code Marking Format**Table 9. Device and Die Revisions**

Member Code	Revisions without Fix	Revision with Fix
5AGXA1	A	B
5AGXA3	A	B
5AGXA5	None	A
5AGXA7	None	A
5AGXB1	A, B and C	D
5AGXB3	A, B and C	D
5AGXB5	A and B	C
5AGXB7	A and B	C
5AGTC3	A	B
5AGTC7	None	A
5AGTD3	A, B and C	D
5AGTD7	A and B	C
5ASXB3	None	A
5ASXB5	None	A
5ASTD3	None	A
5ASTD5	None	A

Note to Table 9:
Future revisions (not shown in the table above) will be CvP capable.

For Gen2 CvP update or further inquiries, please contact [mySupport](#).

Partial Reconfiguration (PR) with Compression Feature Not Supported

The Partial Reconfiguration (PR) with CvP is not supported when compression is turned on and encryption is turned off. There is no restriction when CvP is disabled. [Table 10](#) shows the support of PR with CvP in different states of compression and encryption.

Table 10. PR Support with CvP in Various States of Compression and Encryption

Compression with PR	Encryption with PR	CvP mode	Support
OFF	OFF	On	Yes
OFF	ON	On	Yes
ON	OFF	On	No
ON	ON	On	Yes

Please contact [mySupport](#) for further assistance.

Usermode High Icc

When the affected device transitions into User mode, high Icc is observed, due to internal dataline contention.

Workaround

Use the following software workaround to prevent the user mode high Icc issue:

- For the Error Detection Cyclic Redundancy Check (EDCRC) user, no workaround is needed because the EDCRC feature eliminates the high Icc issue.
- For the non-EDCRC user, a software workaround is needed and is available in the Quartus II software version 12.1 sp1, or later.

Action Needed for Existing Designs (pre-Quartus II software version 12.1 sp1)

Specific action is needed when the existing design uses the EDCRC and certain versions of the Quartus II software. [Table 11](#) lists the actions needed for the different settings.

Table 11. Action for Existing Designs

Design	Quartus II Version	Action
EDCRC enabled.	Any	None needed.
EDCRC disabled	12.1 only	Full recompilation is required using the Quartus II software version 12.1 sp1, or later release.
	Pre 12.1	Full recompilation is NOT needed, but requires the use of Quartus II software version 12.1 sp1, or later for programming file conversion ⁽¹⁾ .

Note to [Table 11](#):

- (1) Convert the existing SOF file to RBF, POF, JIC, or another format using **Convert Programming File**, under the File menu of the Quartus II software.

Unused or Idle Transmitter Maximum Data Rate Degradation

A currently unused or idle transmitter's maximum data rate can degrade over a period. The issue is caused by degradation in the local or central clock divider (used to drive the transmitter) being left idle over an extended period, with the transceiver's power supplies powered up.

The issue only impacts designs that will enable unused or idle transmit channels with idling clock dividers through a new programming file at a later date. The transmit channel in devices that do not power up the transceiver power supplies are not affected.


The idling clock divider can occur in three conditions:

1. Transmit channels in permanent reset
 - a. Transmit channels that will be enabled later are instantiated in the current design, but with the PMA block or divider source clock (CMU PLL or fPLL) held in reset permanently.
2. Unused non-bonded transmit channels
 - a. Non-bonded transmit channels that will be enabled later are not instantiated in the current design, resulting in an idling local clock divider.
3. Unused CMU PLL or fPLL for bonding
 - a. CMU PLL or fPLL used for bonding that will be enabled later are not instantiated in the current design, resulting in an idling central clock divider.

To avoid this issue, ensure the clock dividers that will be enabled later are in the active state in the current programming file. Follow the implementation instructions in [Table 12](#) to avoid this issue.

Table 12. Workaround Implementation Instructions

Scenario	Design Requirement	Future Design Change	Action
1	Fixed transceiver utilization design over device lifecycle (no change to design file)	Not applicable	Do nothing, not affected by issue.
2	Transceiver utilization design will change over device lifecycle	Enable transmit channel held in permanent reset	Leave transmitter <code>tx_analogreset</code> or <code>p11_powerdown</code> signals de-asserted. Keep <code>tx_digitalreset</code> signal asserted and transmits static <code>0x0</code> data.
3		Enable unused non-bonded transmit channel	Instantiate dummy Transmit Only channel in non-bonded mode on every transmit channel that will be enabled later. Share existing active clock resources (CMU PLL or fPLL and input reference clock) if available. Leave transmitter <code>tx_analogreset</code> or <code>p11_powerdown</code> signals de-asserted.
4		Enable unused CMU PLL or fPLL for bonding	Instantiate dummy Transmit Only channel in bonded mode with source PLL assigned to the CMU PLL or fPLL that will be enabled later for bonded configurations. Leave transmitter <code>tx_analogreset</code> or <code>p11_powerdown</code> signals de-asserted.



 The dummy **Transmit Only** channel will increase transceiver power consumption in your design. Use the Early Power Estimator (EPE) tool or PowerPlay Power Analyzer (PPPA) in the Quartus II software to account for the power increase from the additional dummy channels.

Use the following general guidelines for reducing power consumed by the dummy **Transmit Only** channel:

1. In Arria V GT devices, instantiate the dummy channel in PMA direct mode with Native PHY IP.
2. In Arria V GX devices, keep the `tx_digitalreset` signal asserted in dummy channel to minimize PCS activity.
3. Transmit the static `0x0` data over dummy channel.
4. Configure the dummy channel with the lowest possible data rate.
5. Set the `VOD = 6` (minimum value) on the transmitter output pin for dummy channel.
6. From the Quartus II software version 12.1 Service Pack 1 onwards, set **GXB Reserved Transmit Channel** assignment to **ON** on the transmitter output pin for the dummy channel using the Assignment Editor tool. This assignment powers down unnecessary blocks within the dummy channel to reduce power consumption.

Figure 4 shows an example assignment with the Assignment Editor tool.

Figure 4. Example Assignment with the Assignment Editor Tool

	ati	From	To	Assignment Name	Value	Enabled
1		 tx_serial_dummy[1]	tx_serial_dummy[1]	GXB Reserved Transmit Channel	On	Yes

Example assignment with QSF:

- `set_instance_assignment -name GXB_RESERVED_TRANSMIT_CHANNEL ON -to tx_serial_dummy[1].`

False Configuration Failure in Active Serial Multi-Device Configurations

In Active Serial (AS) multi-device configuration mode, the error checking for `CONF_DONE` release may not operate correctly. As a result, you may experience false configuration errors. The failure is indicated by the `CONF_DONE` going high, followed by the `nSTATUS` going low and reconfiguration repeatedly initiated.

Workaround

To resolve this issue, perform both of the following:

1. Disable the `CONF_DONE` error checking in AS multi-device configuration mode:
 - a. If you are using Quartus II software version 12.0 or older, check the “Disable AS mode `CONF_DONE` error check” option. This option can be found in the “Advanced” button, under the Convert Programming File window.
 - b. If you are using Quartus II version 12.0 SP1 or later, the error checking is disabled automatically for AS multi-device configuration POF file generation.

2. Enable the INIT_DONE pin option:
 - a. To ensure a successful configuration, Altera recommends that you enable the INIT_DONE optional pin for devices in the configuration chain. On the board, route out the INIT_DONE pin separately for both the master and slave devices. Monitor the INIT_DONE status for each of the devices to ensure a successful transition into User-mode.



Other configuration modes (JTAG, Fast Passive Parallel (FPP), and Passive Serial (PS) (single and multi device configurations, and AS single-device configurations) are not affected.

Hard Processor System PLL Lock Issue After Power-on Reset or Cold Reset

One or more of the PLLs in the hard processor system (HPS) of Arria V SoC devices can take a long time to lock after power-on reset or cold reset. This occurs when the clock select (CSEL) pins are set to 01, 10, or 11. Some peripherals clocked by the HPS PLLs may fail to operate properly. While this failure is rare, typical symptoms include:

- The HPS hangs during the Boot ROM stage and is unable to proceed to the Preloader stage.
- An intermittent SDRAM calibration error in the Preloader.

Workaround

These issues can be resolved by implementing the following changes:

1. Connect the CSEL pins [1:0] to pull down resistors (4.7 kΩ to 10 kΩ) on the board to force the CSEL input to be 0.
2. Download and install the appropriate SoCEDs patch for software version 13.1 or 14.0. Then, recompile the Preloader code.

To download and install the required SoCEDs patch for SoCEDs version 13.1 and 14.0, refer to [KDB solution rd06202014](#). Software in the patch is integrated into SoCEDs version 14.0.1.


Selecting CSEL=00 causes the Boot ROM to bypass the PLLs on cold reset, instead using the external clock input (`osc_1_clk`) for the peripheral interfaces. Because the external clock is already stable, using it ensures the Preloader code loads properly from external Flash.

The software patch adds code to the Preloader, which locks the PLLs quickly, which in turn resolves the intermittent SDRAM calibration issue. It also loads a piece of code into the on-chip RAM to handle a warm reset. Clocks are handled differently depending on whether the reset is warm or cold.

Workaround Implications

Bypassing the PLLs after cold reset increases the boot time slightly because the external clock is slower than the Flash interface clock generated from the HPS peripheral PLL.

Altera reserves the upper 4 KB of on-chip RAM for the warm boot code.

 Do not overwrite the content of the upper 4 KB of the address range in the on-chip RAM. If you need a smaller memory footprint for the code, file a service request using [mySupport](#).

The on-chip memory restriction can be eliminated entirely if the SoC warm and cold reset pins are tied together, or if the HPS boots from FPGA memory.

Device and Revision Fixed


[Table 13](#) identifies the fixed silicon by die revision for each device.

Table 13. Device and Revision Fixed

Device	Revision Without Fix	Revision With Fix
5ASXB3	Rev C	Rev D
5ASXB5	Rev C	Rev D
5ASTD3	Rev C	Rev D
5ASTD5	Rev C	Rev D

[Figure 5](#) shows the silicon revision as identified by the 4th letter of the Lot ID.

Figure 5. Altera Date Code Marking Format

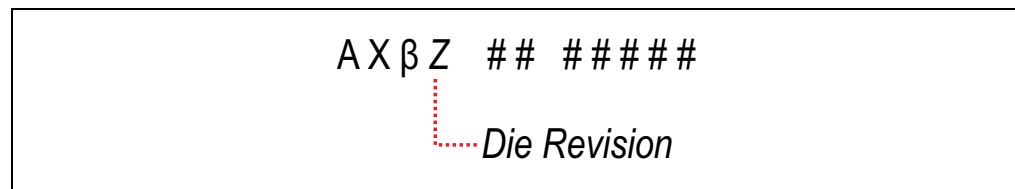

Signal Detect Issue in PCIe Configuration

The Signal Detect (SD) circuit required in the PCIe configuration (Hard IP and PIPE mode) may switch OFF for both of the following conditions:

- Low temperature
- Upper limit of V_{CCER_GXB} (receiver buffer power supply voltage)

PCIe link training may not be fully completed in the case where the SD circuit remains de-asserted or OFF with an incoming signal.

This issue is a time-zero condition. If shipped devices have been tested and do not exhibit this issue, it will not occur in the future.

Workaround

Perform the following procedure:

1. Update the Quartus Prime settings for the receiver common mode voltage (RX V_{CM}) and receiver signal detect circuit threshold (RX V_{TH}) with the settings listed in [Table 14](#).

Table 14. RX V_{CM} and V_{TH} Settings

Device	V_{CCER_GXB} Voltage	RX V_{CM} Voltage	RX V_{TH} Settings
Arria V GX/SX	1.1 V / 1.15 V	0.7 V	5

For more information about how to update V_{CM} and V_{TH} settings, refer to the [Why does the PCI Express channel fail link training at low temperature in Arria V GX and SX devices? KDB solution](#).

2. Move to production devices with date code 1707 and onwards.

If you are unable to apply these changes to resolve the issue, contact [mySupport](#) for additional information.

Document Revision History

[Table 15](#) lists the revision history for this errata sheet.

Table 15. Document Revision History (Part 1 of 2)

Date	Version	Changes
March 2017	3.1	<ul style="list-style-type: none"> ■ Changed the name of the referenced KDB solution in the “Signal Detect Issue in PCIe Configuration” section.
March 2017	3.0	<ul style="list-style-type: none"> ■ Changed “VCCR_GXB” to “VCCER_GXB” in the “RX V_{CM} and V_{TH} Settings” table. ■ Updated the KDB URL in the “Signal Detect Issue in PCIe Configuration” section.
February 2017	2.9	<ul style="list-style-type: none"> ■ Added the “Signal Detect Issue in PCIe Configuration” section.
September 2015	2.8	<ul style="list-style-type: none"> ■ Added the “JTAG Programming of 28-nm Devices” section.
December 2014	2.7	<ul style="list-style-type: none"> ■ Added the “EMAC RMI PHY Interface is Only Supported Through the FPGA Fabric” section. ■ Clarified Step 1 in the “Workaround” section of the “Hard Processor System PLL Lock Issue After Power-on Reset or Cold Reset” section.
December 2014	2.6	<ul style="list-style-type: none"> ■ Added the 5ASXB3 device to the “Device and Revision Fixed” table in the “Hard Processor System Level 2 Cache Error Correction Code” section.
November 2014	2.5	<ul style="list-style-type: none"> ■ Made the following changes to the “Hard Processor System PLL Lock Issue After Power-on Reset or Cold Reset” section: <ul style="list-style-type: none"> ■ Defined the die revision where the fix will be implemented. ■ Added the “Device and Revision Fixed” table. ■ Added the “Altera Date Code Marking Format” figure.
August 2014	2.4	<ul style="list-style-type: none"> ■ Added the “Hard Processor System PLL Lock Issue After Power-on Reset or Cold Reset” section. ■ Changed the date code designator in Figure 1.
April 2014	2.3	<ul style="list-style-type: none"> ■ Updated the “Hard Processor System Level 2 Cache Error Correction Code” section to include Table 2 and Figure 1. ■ Updated Figure 3.

Table 15. Document Revision History (Part 2 of 2)

Date	Version	Changes
December 2013	2.2	<ul style="list-style-type: none"> ■ Added the “Hard Processor System Level 2 Cache Error Correction Code” section. ■ Updated the “EMIF Maximum Frequency Specification Update” section.
October 2013	2.1	<ul style="list-style-type: none"> ■ Updated Table 2.
October 2013	2.0	<ul style="list-style-type: none"> ■ Added the “EMIF Maximum Frequency Specification Update” section. ■ Updated Table 1. ■ Updated the “Configuration via Protocol (CvP)” section. ■ Updated the “SEU Internal Scrubbing” section.
July 2013	1.9	<ul style="list-style-type: none"> ■ Added the “SEU Internal Scrubbing” section. ■ Removed the “Partial Reconfiguration (PR) with Compression Feature Not Supported” section.
June 2013	1.8	<ul style="list-style-type: none"> ■ Updated the Altera fPLL Usage Evaluation Tool package in the “Fractional PLL Phase Alignment Error” section.
May 2013	1.7	<ul style="list-style-type: none"> ■ Added “Fractional PLL Phase Alignment Error”
May 2013	1.6	<ul style="list-style-type: none"> ■ Updated Table 2.
April 2013	1.5	<ul style="list-style-type: none"> ■ Added the “Bit Errors on the LVDS RX Channels Using DPA” section.
February 2013	1.4	<ul style="list-style-type: none"> ■ Updated Table 1. ■ Removed the “Missing Delay” section.
January 2013	1.3	<ul style="list-style-type: none"> ■ Updated the “Unused or Idle Transmitter Maximum Data Rate Degradation” section. ■ Added the “Configuration via Protocol (CvP)” section. ■ Added the “Missing Delay” section. ■ Updated the “Usermode High Icc” section. ■ Added the “Partial Reconfiguration (PR) with Compression Feature Not Supported” section. ■ Updated Table 4.
December 2012	1.2	Added the “Usermode High Icc” section.
November 2012	1.1	Added the “Unused or Idle Transmitter Maximum Data Rate Degradation” section.
October 2012	1.0	Initial release.